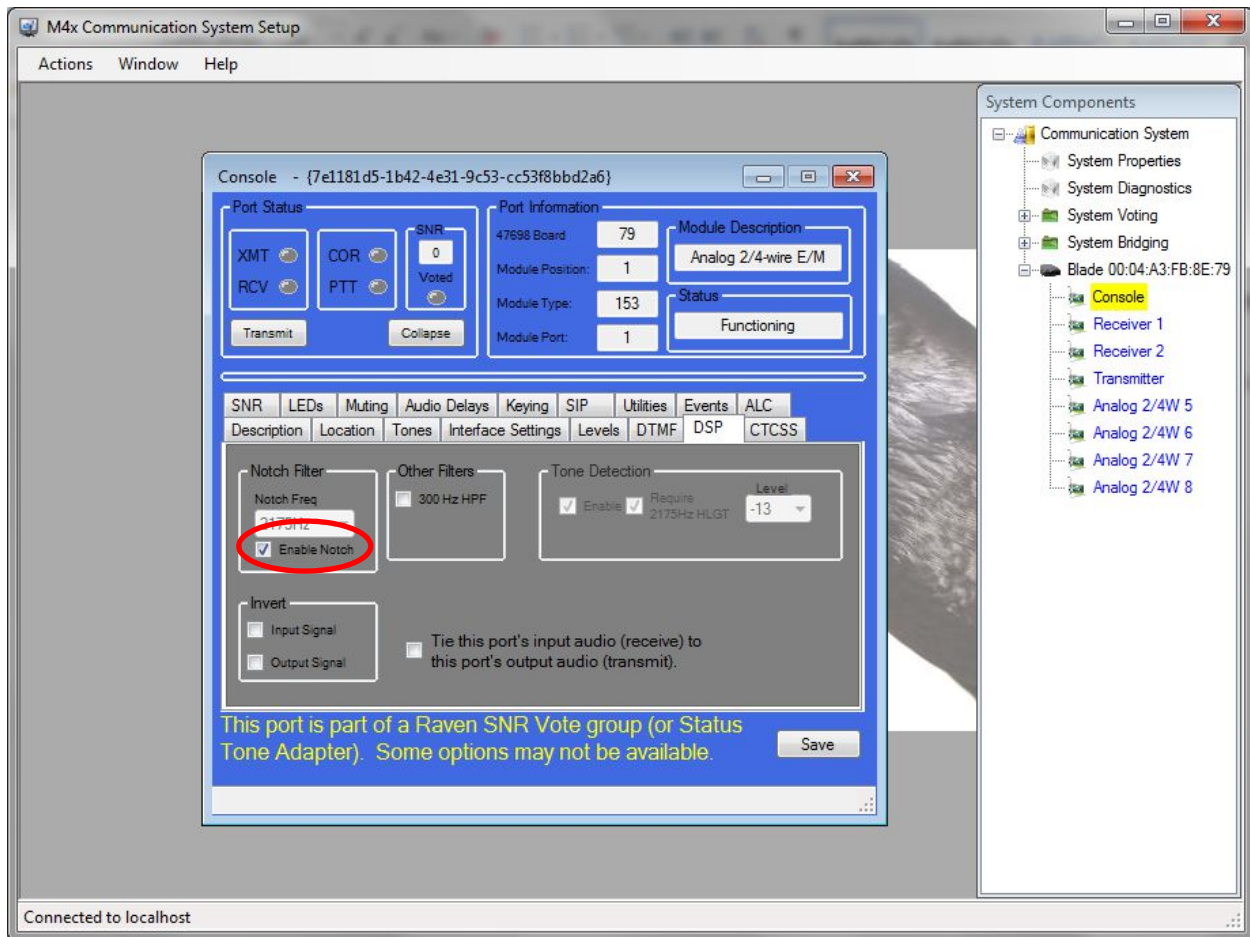# TECHNICAL NOTES

TN131 Notch Filter Disables when Connecting to Software

Notch Filter Disables when Connecting to Software

Overview: After configuring a voter with the notch filter enabled on a port, the notch filter stops working when the unit is connected to the M4x software again.

Solution: After connecting to the software again, go to the **"DSP"** tab of the port(s) on which the notch filter is disabled. Even though the **"Enable Notch"** box is checked, you will need to uncheck and then recheck the box again for the filter to function. When done, click the **"Save"** button in the lower right. See screen shot below.

Note: Be sure to perform this process any time you make changes to the voter configuration and before you save those changes to Flash.